

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 99.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-024128**Date Inspected:** 29-May-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 1500**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 300**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC) Chanxing Island**Location:** Shanghai, China**CWI Name:** Lv Li Qing**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Bike Path, OBG 14E**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Dennis Combs, was present during the times noted above for the observations relative to the work being performed.

This Quality Assurance (QA) Inspector has performed documentation review of the Green Tag system utilized by American Bridge/Flour (ABF) and Caltrans METS. This QA Inspector has Identified Complete Joint penetration (CJP), Partial Joint Penetration (PJP), and Fillet Welds in Lift 13BE. He has also verified the Non-Destructive Testing requirements for each weldment that includes the NDT process (UT, MT, and RT) and the percentage required by the contractor to perform. These items are within the Contract special provision, CCO 22 and within compliant of CCO 77. This information has been documented and compiled in a Green Tagging spread sheet that is located on the Caltrans Team China Z; drive.

BAY 11

This Caltrans QA inspector received ZPMC non-destructive test (NDT) notification number 09298 from ZPMC for Bay 11. This QA inspector performed magnetic particle testing (MT) verification of welds after ZPMC had performed their MT inspection. The segment is identified as OBG Bike Path. The weld designations reviewed are as follows.

BK011A2-001-016, 018 (A Side)

BK012A2-001-016, 018 (B Side)

WELDING INSPECTION REPORT

(Continued Page 2 of 2)

TRIAL ASSEMBLY YARD

This Caltrans QA inspector received ZPMC non-destructive test (NDT) notification number 09300 from ZPMC for Trial Assembly Yard. This QA inspector performed magnetic particle testing (MT) verification of welds after ZPMC had performed their MT inspection. The segment is identified as OBG 14E. The weld designations reviewed are as follows.

SEG3019AF-119, 131~134


SA7034-001-035~040

SA7050-001-001, 002, 004~007

SEG3019AE-068, 069, 081, 082, 088~091, 094~097, 119, 120, 133~136

SEG3019AF-068, 069, 083, 084, 091~094, 097~100, 110, 111, 125~128

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

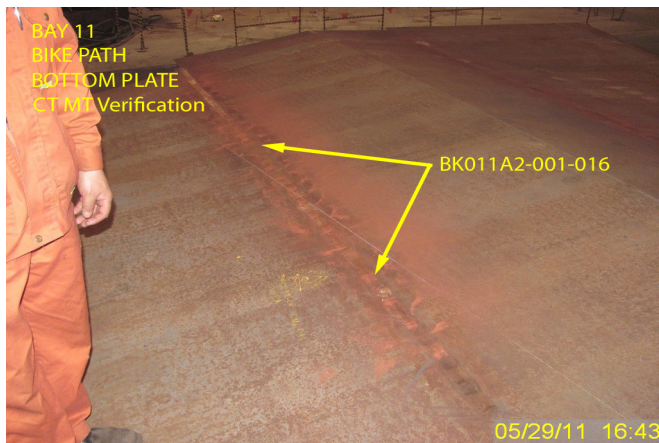

Summary of Conversations:

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact , who represents the Office of Structural Materials for your project.

Inspected By:	Combs,Dennis	Quality Assurance Inspector
Reviewed By:	Riley,Ken	QA Reviewer
